

KENWOOD

#874

SERVICE BULLETIN

AMATEUR RADIO


SUBJECT

TS-930S RF FEEDBACK


DATE

7-15-83

For reports of RF Feedback from the external speaker, especially when using a vertical antenna, or a linear amplifier, check for correct installation of capacitor C16 on the EXT. SPKR jack.

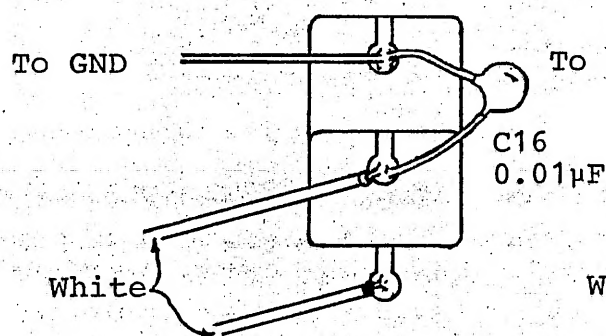

INCORRECT

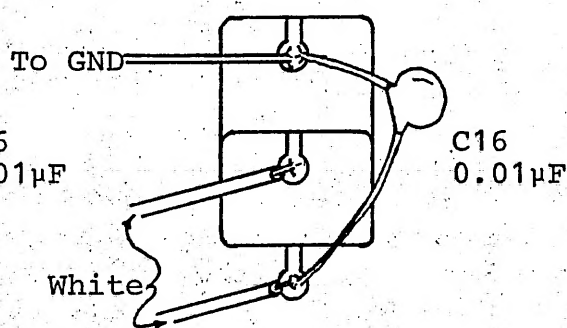

CORRECT

Note: This bulletin is applicable to radios with serial numbers prior to # 3070420. Time required for this procedure is ½ hour or less.

CLM/TK